

Work Order ID 119306

May 15-14 12:41:40 PM

119306

Page 1

Item ID: D2580-1

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: 205 Bent Tube

Start Date: 5/15/14 Start Qty: 4.00 ***4***

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 4.00 ***4***

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 14-05-15 Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D2580	G
-------	---

100 0.00

100

Skid tubes

Memo

0.00

Skid tubes

1- Inspect mat'l D2500-1-190 for damage.

2-Drill pilot holes using drill jig DT 8149 A-BC-D

3-Open holes to 0.508" as per Dwg D2580

4-Deburr holes per QSI002 section 4.2.3 and blow out all chips from inside of tube

5- Test fit inspection saddles on FWD & AFT saddle holes using DT9916.

101 QC6- Inspect dimensions to drawing 0.00

101

QC

Memo

0.00

Quality Control

14-5-16 JLD

SM
14/5/16

4

Work Order ID 119306

May-15-14 12:41:40 PM

119306

Page 2

Item ID: D2580-1

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: 205 Bent Tube

Start Date: 5/15/14 Start Qty: 4.00

4

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 4.00

4

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursTool ID Tool # Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

110

Chemical Conversion Coat per QSI005 4.1

0.00

110

HandFinish

Memo

0.00

Hand Finishing

14-5-16 JLL/DGL

120

QC7-Inspect Chemical Conversion Coat

0.00

120

QC

Memo

0.00

Quality Control

4 14-5-16

125

0.00

125

Skidtubes

Memo

0.00

Skidtubes

1- Bond web in place per QSI 015.

A/R Sikaflex-291 batch: 128569
Sikaflex expire date: 14-11-20
Start time and date: 10:25 14-5-16 bond for 12hrs

4 14-5-16 DGL JLL

Work Order ID 119306

May-15-14 12:41:40 PM

119306

Page 3

Item ID: D2580-1

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: 205 Bent Tube

Start Date: 5/15/14 Start Qty: 4.00 ***4***

Cust Item ID:

Required Date: 5/15/14 Req'd Qty: 4.00 ***4***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130 QC5- Inspect part completeness to step on W/O 0.00

130

QC

Quality Control

Memo

0.00

DAS
03
9-89

[Signature] 14-5-20

140 Identify as per dwg & Stock Location: *46* 0.00

140

Packaging

Packaging

Memo

0.00

[Signature] 14-5-20 *(4)*

150 QC21- Final Inspection - Work Order Release 0.00

150

QC

Quality Control

Memo

0.00

14/5/20 *[Signature]*

MF
14-5-20

Picklist Print

May-15-14 12:41:43 PM

Page 1

Work Order ID: 119306

119306

Parent Item: D2580-1

D2580-1

Parent Item Name: 205 Bent Tube

Start Date: 5/15/14

Required Date: 5/15/14

Start Qty: 4.00

Required Qty: 4.00

Comments: IPP B01.11.08 Revised Step 9, 10, 12, and 13 SM IPP Rev:C
10.12.01 as per DEO D1 DD ver:ec

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured No

100

Each

14.0000

1

4

D2500-1-190

Ext'n -1' Beam Tube 4"

Location

Loc Qty

Loc Code

HALL

14

105279

14

D2596

Manufactured No

100

Each

14.0000

1

D2596

Web, 205 Skidtube

Location

Loc Qty

Loc Code

LG

2

117434

2

LG002

12

109808

4

117843

8

④ 14-5-16 J4/720

④ 14-5-16 J4/DGL

LIST OF MATERIALS						PART NUMBER	DESCRIPTION
ITEM	QTY -041	QTY -045	QTY -047	QTY -049			
1	X					D2580-041	SKIDTUBE ASSEMBLY
2		X				D2580-045	SKIDTUBE ASSEMBLY
3			X			D2580-047	SKIDTUBE ASSEMBLY
4				X		D2580-049	SKIDTUBE ASSEMBLY
20	1	1	1	1		D2500-1-190	EXTRUSION
21			16	16		D2570	BUSHING
22	1	1	1	1		D2576-3	STEP
23		4				D2579	SPACER
24	16	16	8	8		D2594-1	PLUG
25	16	16	8	8		D2594-3	O-RING
26	1	1	1	1		D2596	205 WEB
27	1	1	1	1		D2855	AFT CAP
28	1	1				D3564-5	WEARSHOE
29	1	1				D3564-9	WEARSHOE
30	1	1				D3564-11	WEARSHOE
31	1	1				D3564-13	WEARSHOE
32	2	2				D3566-1	GASKET
33	1	1				D3566-5	GASKET
34	1	1				D3566-13	GASKET
35	20	20	24	24		D4202-1	SPACER
36			1			D4406-041	WEARPLATE ASSEMBLY
37			1			D4406-043	WEARPLATE ASSEMBLY
37				1		D5061-1	FWD WEARPLATE
37				1		D5061-3	AFT WEARPLATE
50	50	50				ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
51	50	50				AN3C4A	BOLT
52	2	2	2	2		AN3-5A	BOLT
53			8	8		AN4-45A	BOLT
54	50	50				NAS1149C0332R	WASHER (AN960C10L)
55	2	2	2	2		NAS1149D0332J	WASHER (AN960JD10L)
56			8	8		MS21042-4	NUT (OR MS21042L4)


GENERAL NOTES:

- MATERIAL: N/A
- FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3 POWDER COAT ASSEMBLY (-045) GREEN SANDTEX (REF 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: NONE
- WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- WELDING PER DART QSI 004.
- INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL 20.287 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/291.
- INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2014-04-29

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 119306 MJS
17-05-15


G	ADDED -049, -047 WEIGHT UPDATED PER DSI 9598	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	15	D2580	SHEET 1 OF 9
APPROVED	19	TITLE	SCALE
DE APPR.	21	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1995 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

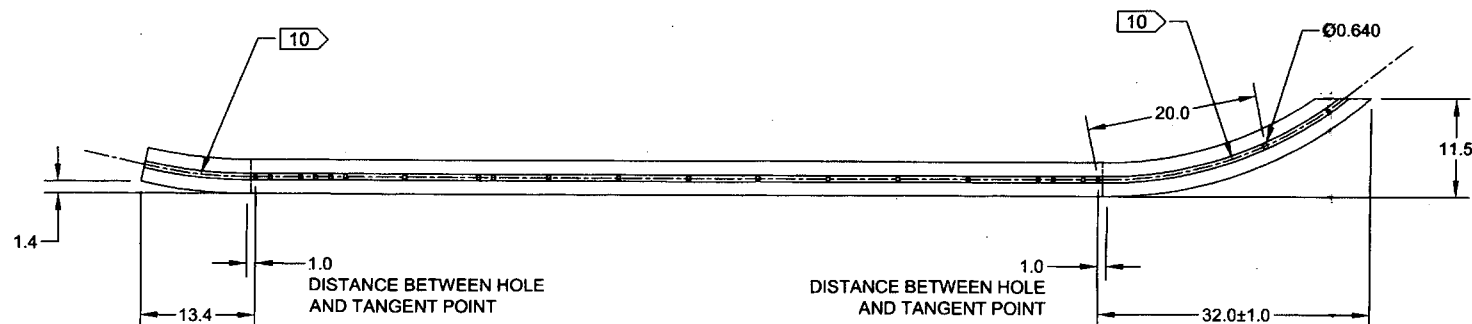


D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>A.P.</i>	D2580	SHEET 3 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

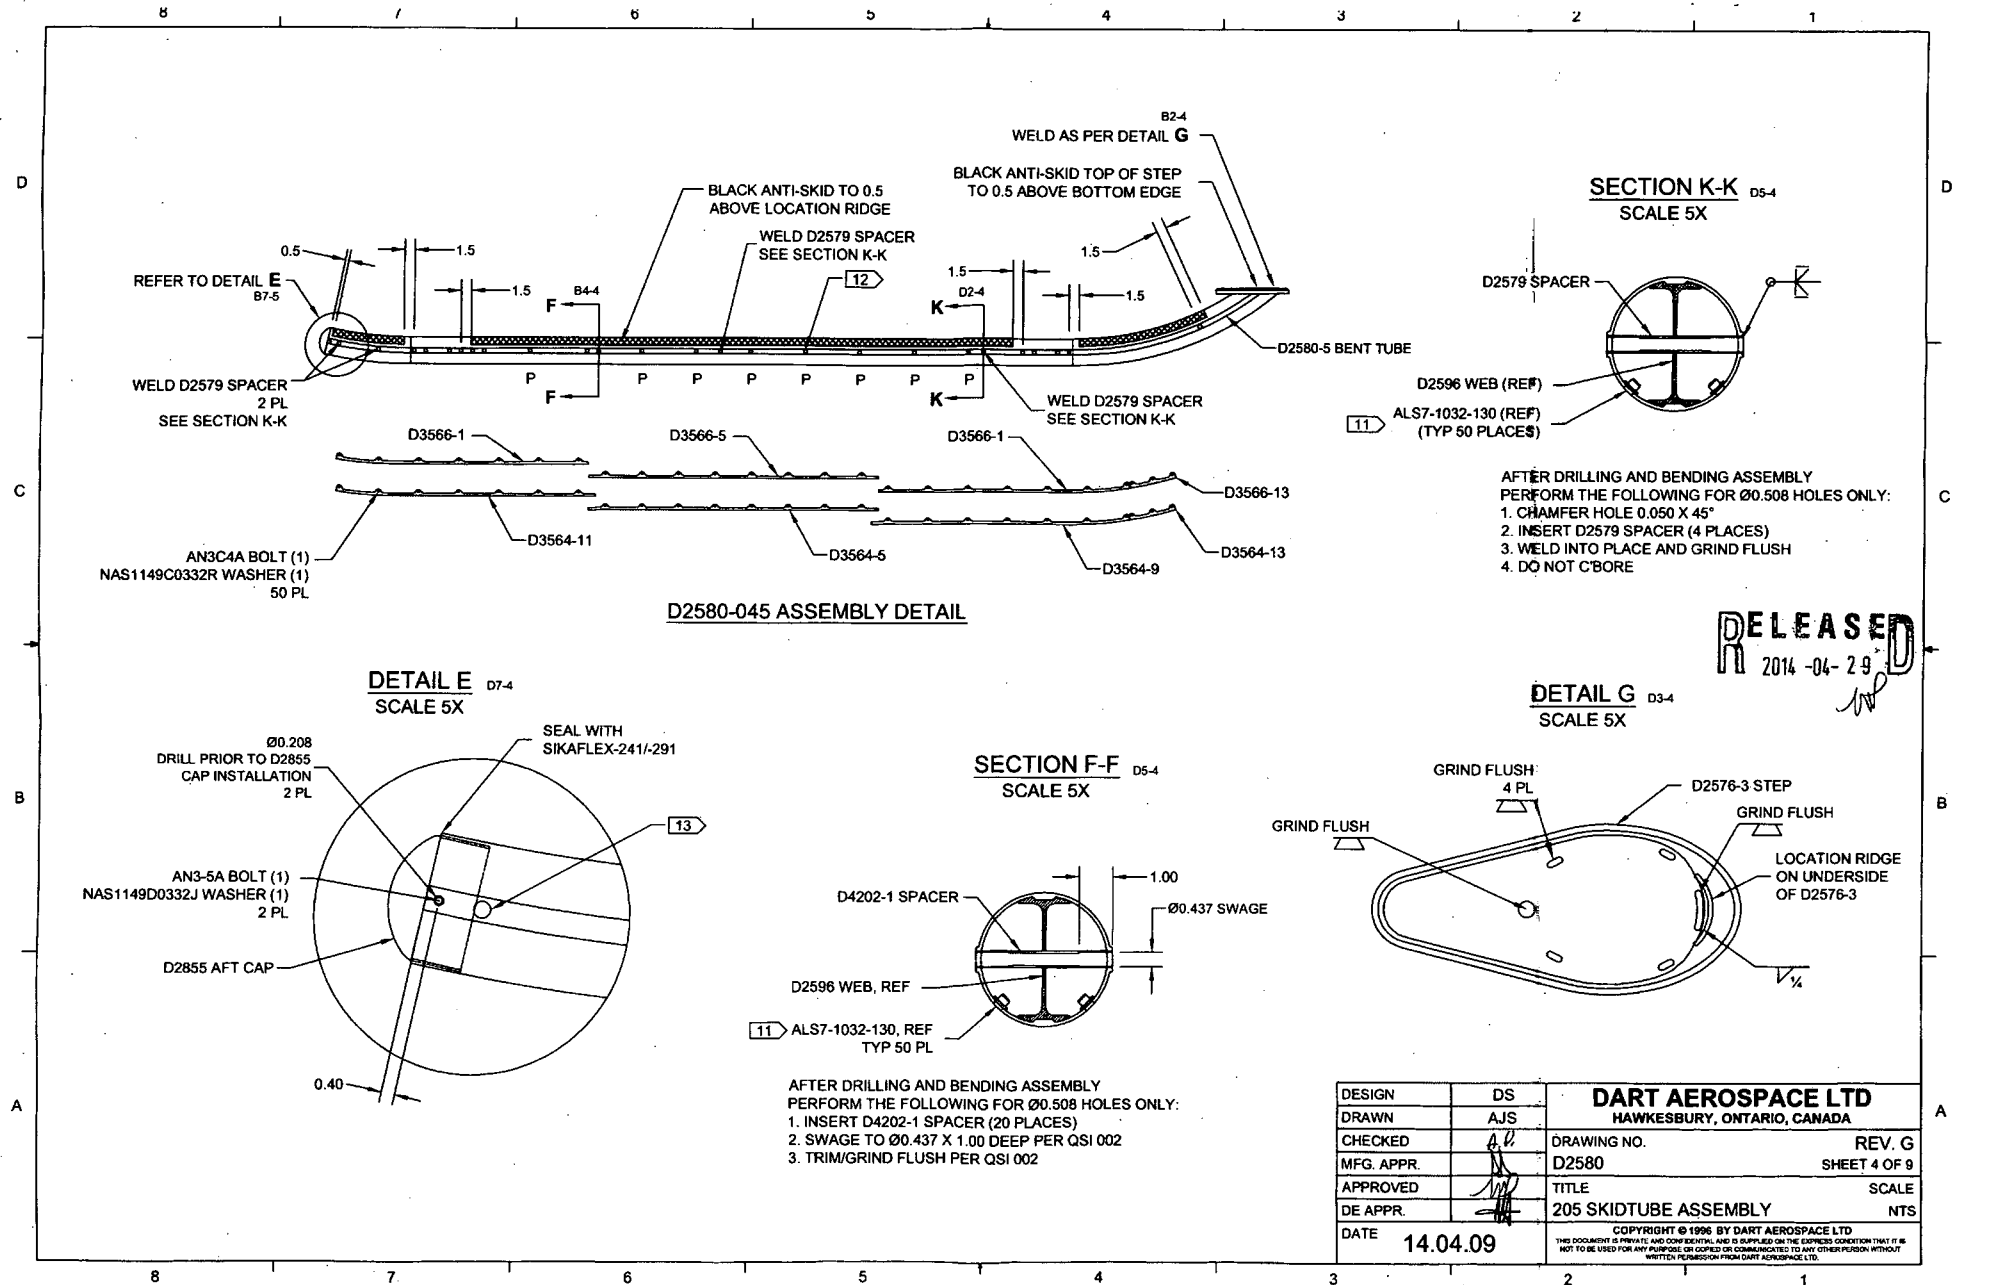


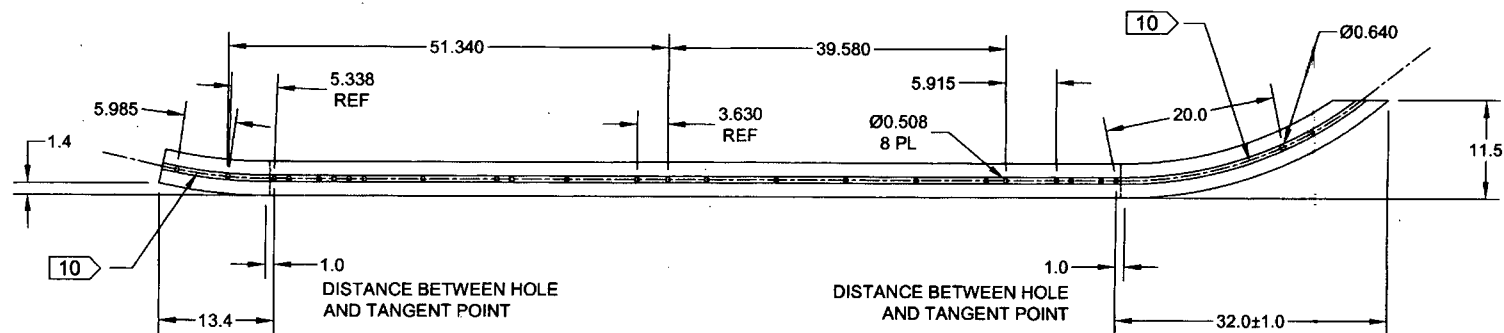


D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29


DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	[Signature]	D2580	SHEET 5 OF 9
APPROVED	[Signature]	TITLE	SCALE
DE APPR.	[Signature]	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

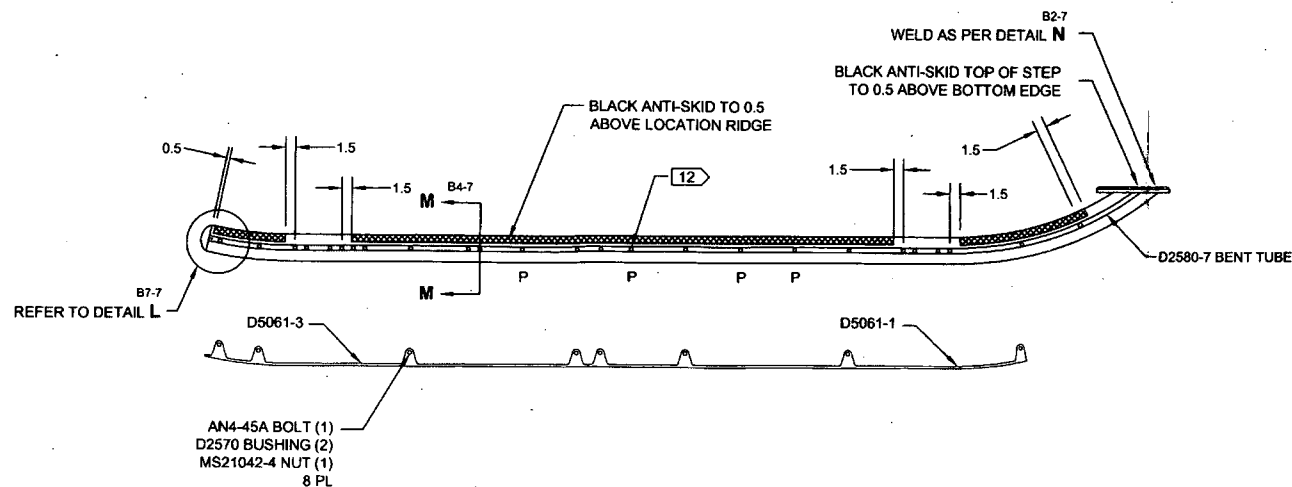


D2580-049 ASSEMBLY DETAIL G

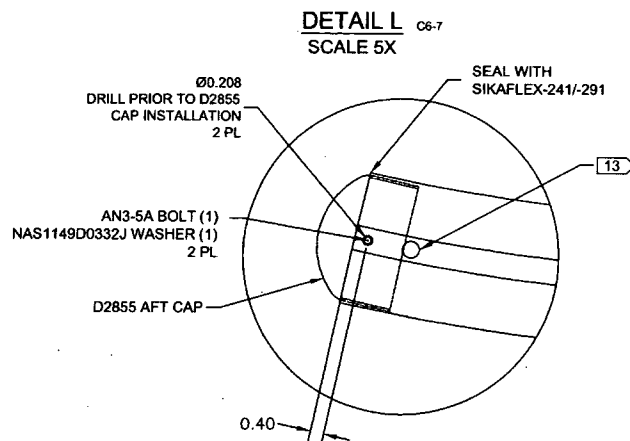

SECTION M-M D5-7
SCALE 5X

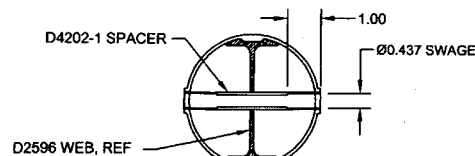


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

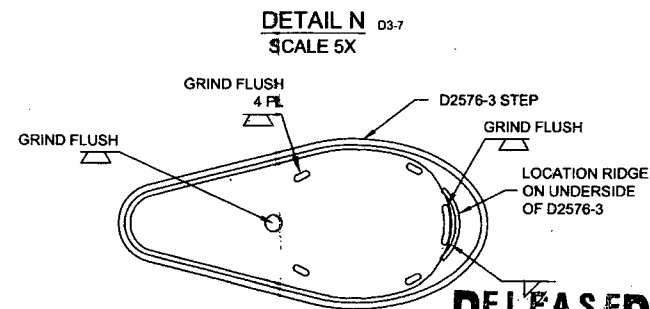

RELEASED
2014-04-29


DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	A.P.	D2580	SHEET 7 OF 9
APPROVED	A.P.	TITLE	SCALE
DE APPR.	A.P.	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

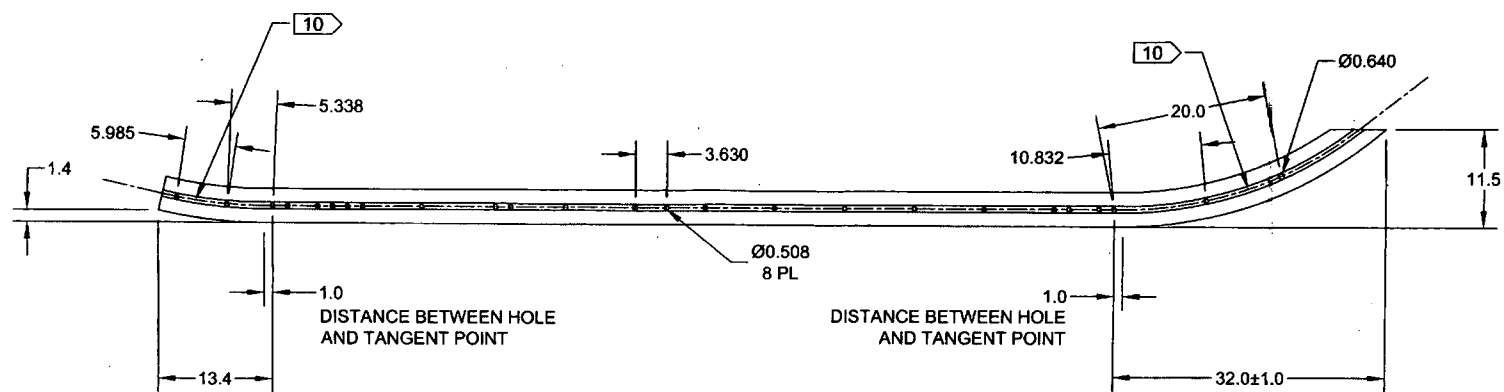


D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	[Signature]	D2580	SHEET 8 OF 9
APPROVED	[Signature]	TITLE	SCALE
DE APPR.	[Signature]	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

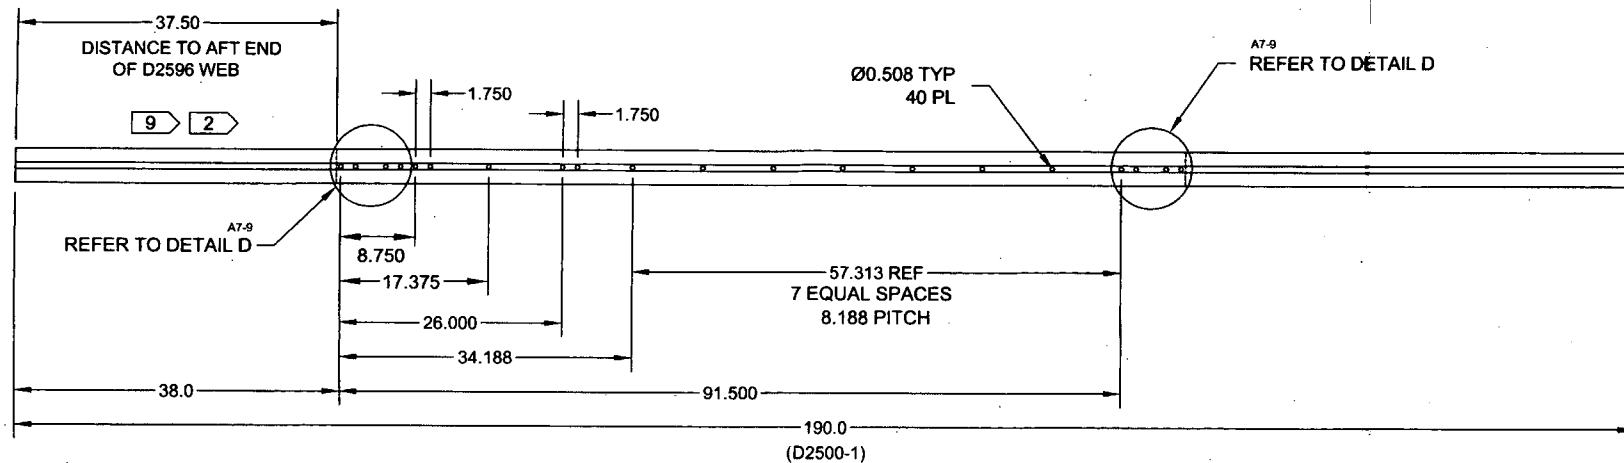

D2580-101 TUBE

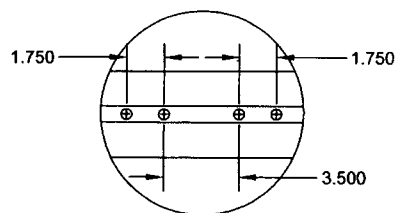

DETAIL D
SCALE 5X

C3-9
C7-9

RELEASED
2014-04-29
WFO

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	A.P.	D2580	SHEET 9 OF 9
APPROVED	WFO	TITLE	SCALE
DE APPR.	WFO	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	<small>COPYRIGHT © 1995 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR COPIED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--